

### 1. Befüllen mit einem Fettpressenfüllgerät

Füllnippel auf den Füllstutzen des Füllgerätes aufsetzen und andrücken. Dann den Handhebel des Füllgerätes solange betätigen bis die Kolbenstange der Hebelpresse ganz heraussteht bzw. ein Widerstand spürbar ist. Presse vom Füllgerät abnehmen. Kolbenstange durch Druck auf den Klemmhebel lösen und vollständig einschieben. Bei Lufteinschluss über Füll- bzw. Entlüftungsnippel entlüften.

### 2. Befüllen mit einer Fettkartusche

Pressenkopf abschrauben, Kolbenstange bis Anschlag herausziehen, beidseitig geöffnete Kartusche in das Pressenrohr einführen. Pressenkopf wieder aufschrauben, Kolbenstange durch Druck auf den Klemmhebel lösen und vollständig einschieben. Bei Lufteinschluss über den Füll- bzw. Entlüftungsnippel entlüften.





### 3. Befüllen mit einem Spachtel






Pressenkopf abschrauben. Herausziehen der Kolbenstange und blasenfreies Fetteinfüllen in kleinen Schritten wechselseitig vornehmen bis Presse gefüllt ist. Pressenkopf wieder aufschrauben, Kolbenstange durch Druck auf den Klemmhebel lösen und vollständig einschieben. Bei Lufteinschluss über den Füll- bzw. Entlüftungsnippel entlüften.

### 4. Befüllen durch Ansaugen aus einem Fetteimer

Pressenkopf abschrauben. Pressenrohr bis zur 1. Rändelung in das Fett stecken und durch langsames Herausziehen der Kolbenstange Fett in das Pressenrohr saugen, bis Presse gefüllt ist. Pressenkopf wieder aufschrauben, Kolbenstange durch Druck auf den Klemmhebel lösen und vollständig einschieben. Bei Lufteinschluss über den Füll- bzw. Entlüftungsnippel entlüften.

Fettpresse ausschließlich für bestimmungsgemäßen Einsatz vorgesehen. Nicht bestimmungsgemäßer Gebrauch und unsachgemäße Handhabung können schwere Verletzungen zur Folge haben. Niemals Handhebel mit Gewalt betätigen oder durch zusätzliche Teile verlängern. Unter hohem Druck stehende Teile niemals auf Menschen oder Tiere richten. Während des Abschmierens Schutzbrille und Schutzhandschuhe tragen. Druckbereich bis 800 bar möglich! Angegebene Berstdrucke der verwendeten Schläuche beachten. Hochdruck-Gummipanzerschlauch  $\varnothing$  13 mm, Berstdruck = 1650 bar. Schlauchleitungen mit Sorgfalt behandeln und nicht knicken. Biegeradius von 5 cm nicht unterschreiten. Vor Gebrauch Schläuche auf Unversehrtheit und auf ordnungsgemäße Verbindung mit Fettpresse überprüfen. Beschädigte Schläuche und Schläuche, die älter als 3 Jahre sind, ersetzen. Verwenden Sie ausschließlich geprüftes Originalzubehör, andere Schläuche dürfen nicht verwendet werden! Zur Montage der Schläuche nur geeignetes Werkzeug verwenden. Fette bis NLGI2, DIN 51818

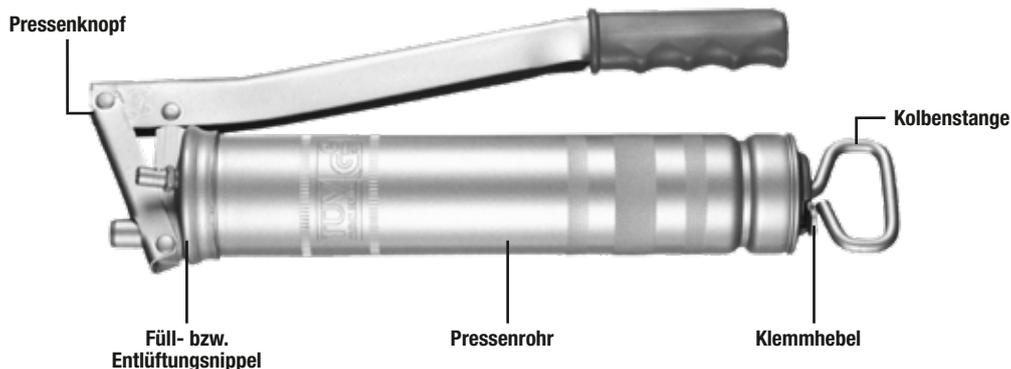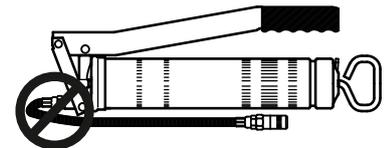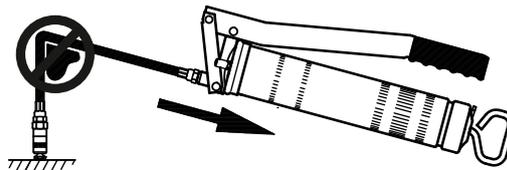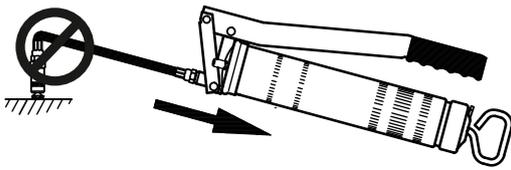

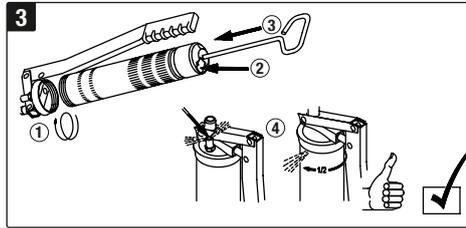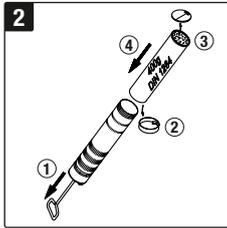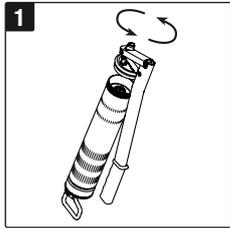
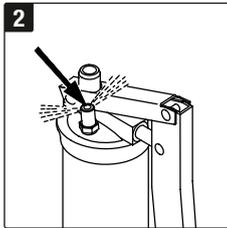
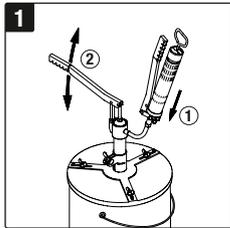


### 1. Filling the grease gun using a grease gun filling device

Place the filling nipple on the filling nozzle and press the nipple against the nozzle. Then, use the hand lever of the filling device until the piston rod of the lever press sticks out entirely or you can feel resistance. Detach gun from filling device. Release the piston rod by pressing on the clamping lever and insert rod completely. In case of trapped air, remove air via the filling or ventilation nipple.




### 2. Filling the grease gun using a grease cartridge

Unscrew grease gun head, pull out piston rod as far as possible, insert the cartridge open on both sides into the grease gun tube. Screw grease gun head on again, release piston rod by pressing on the clamp lever and insert it completely. In case of trapped air, remove air via the filling or ventilation nipple.

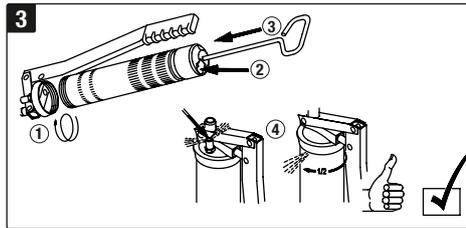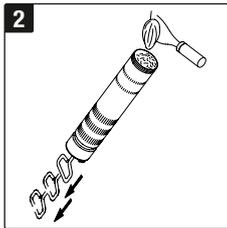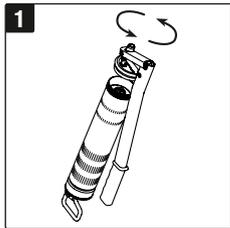

### 3. Filling the grease gun using a grease spatula

Unscrew the grease gun head. Pull out the piston rod and fill in the grease alternatingly from both sides without causing bubbles until the gun is filled. Screw gun head on again, release the piston rod by pressing on the clamping lever and insert rod completely. In case of trapped air, remove air via the filling or ventilation nipple.

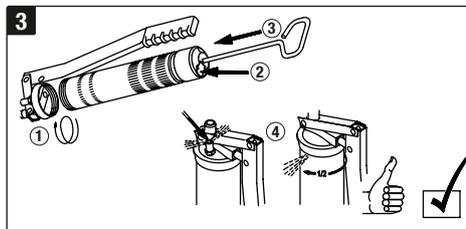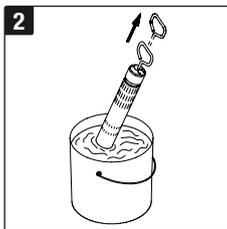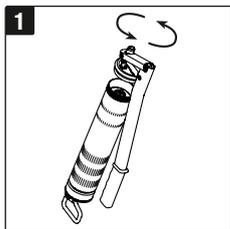

### 4. Filling by suction from a grease bucket

Unscrew the grease gun head. Put grease gun tube into grease up to the first knurling and suck grease into the grease gun tube by slowly pulling out the piston rod until gun is filled. Screw gun head back on, release piston rod by pressing on the clamping lever and insert rod completely. In case of trapped air remove air via the filling or ventilation nipple.

Only use grease guns as directed. Improper use can cause severe injuries. Never use excessive force on the lever, or lengthen it with other components. Never point high pressure parts at people or animals. During use wear industrial gloves and safety glasses. Pressures of around 800 bar are possible! Be aware of the stated burst pressures of our hoses!  $\varnothing$  13mm high pressure armoured rubber hose, burst pressure = 1650 bar. Treat hoses with care and never allow them to kink. Do not let the bend radius go below 5 cm. Before use check hoses for damage, leaks and loose connection. Always replace damaged hoses or hoses more than 3 years old. Only use genuine accessories, no other hoses must be used! Only use suitable tools when fitting hoses. Grease up to NLGI 2, DIN 51818

